

## 작업지시 내역(8차 지시)

□지시일자: 2019.06.28

□작업기간: 2019.06.28~07.30

□계약상대자: 기 경 건 설

□내 용: 소규모 인력포장(소파보수)

공 종	개소	수량(m2)	아스콘(톤)
계	42.00	1,908.75	340.50
소파보수, 인력, T=5cm(야간)	28	931.90	109.96
소파보수, 인력, T=10cm(야간)	14	976.85	230.54



□ 작업지시내역:

연번 No.	위치		행선	폭(m)	연장(m)	개소	면적(m <sup>2</sup> )	현황	보수방법	작업조건		비 고	조사번호
	노선명	공사구간(지점)								주간	야간		
계						1908.8							
1	독성로	671	시내방향 1차로	3	8	1	24	포트홀	인력, t=5cm		○		349
2	독성로	657	시내방향 1차로	4.4	18.5	1	81.4	균열,포트홀,침하	인력, t=10cm		○		350
3	독성로	639	시내방향 1차로	3.3	6	1	19.8	포트홀	인력, t=5cm		○		351
4	독성로	629 맛있는돼지	시내방향 1차로	3.2	7.3	1	23.36	균열,포트홀,침하	인력, t=5cm		○		352
5	독성로	625 복권판매점	시내방향 1차로	3	8	1	24	포트홀	인력, t=5cm		○		353
6	독성로	603	시내방향 1차로	4	12	1	48	균열	인력, t=10cm		○		354
7	독성로	601	시내방향 1차로	4	12	1	48	균열,침하	인력, t=10cm		○		355
8	독성로	587 제일은행	시내방향 1차로	3.3	22.5	1	74.25	균열	인력, t=10cm		○		356
9	독성로	585 덕향기	시내방향 2차로	3.4	7	1	23.8	균열,침하	인력, t=5cm		○		357
10	독성로	585 감탄떡볶이	시내방향 2차로	3.4	7	1	23.8	균열	인력, t=5cm		○		358
11	독성로	569 우성아파트 103동 앞	시내방향 2차로	3.4	13	1	44.2	균열,포트홀,침하	인력, t=10cm		○		359
12	독성로	569 우성아파트 104동 앞	시내방향 2차로	3.4	7	1	23.8	균열	인력, t=5cm		○		360
13	독성로	569 우성아파트 104동 앞	시내방향 2차로	3.4	14	1	47.6	균열	인력, t=5cm		○		361
14	능동로	31	한강방향 1차로	3.4	7	1	23.8	균열,침하,포트홀	인력, t=5cm		○		362
15	능동로	29	한강방향 1차로	3.4	7	1	23.8	균열,침하,포트홀	인력, t=5cm		○		363
16	능동로	18	중곡역방향 2차로	3	7	1	21	균열,침하	인력, t=5cm		○		364
17	능동로	18	중곡역방향 1차로	3	7	1	21	균열,침하	인력, t=5cm		○		365
18	능동로	50	중곡역방향 2차로	3.5	7	1	24.5	균열,포트홀,침하	인력, t=5cm		○		366
19	능동로	90 THE CLASSIC 500	중곡역방향 3차로	3	16	1	48	침하	인력, t=10cm		○		367
20	능동로	53 대동아파트 103동 앞	한강방향 2차로	3.3	7.5	1	24.75	균열	인력, t=5cm		○		368
21	독성로	365 성수공고	시내방향 2차로	4	6	1	24	균열,침하	인력, t=5cm		○		369
22	독성로	327 프롬하츠커피	시내방향 1~2차로	6.2	8	1	49.6	균열,침하	인력, t=10cm		○		370
23	독성로	325-1 세계부동산	시내방향 2차로	3	8	1	24	균열	인력, t=5cm		○		371
24	독성로	321-1 G3	시내방향 1~2차로	6.2	4	1	24.8	균열,침하	인력, t=5cm		○		372
25	무학로	홍익동613 양지사거리 내	상왕십리방향 2~3차로	4.5	9	1	40.5	침하,소성변형	인력, t=5cm		○		375
26	행당로	129	신금호역방향 2차로	3.2	15.2	1	48.64	균열,침하,물고임	인력, t=5cm		○		376
27	행당로	행당동 347-9 대림아파트 107동 앞	신금호역방향 2차로	3.7	25	1	92.5	균열,침하	인력, t=10cm		○		378
28	행당로	75	신금호역방향 2차로	4.4	20	1	88	균열	인력, t=10cm		○		379
29	행당로	82 한진아파트 201동 앞	고산자로방향 2차로	3.7	22	1	81.4	균열	인력, t=10cm		○		380
30	행당로	82 한진아파트 202동 앞	고산자로방향 2차로	3.8	25	1	95	균열	인력, t=10cm		○		381
31	행당로	82 행당어린이집	고산자로방향 2~3차로	5.5	15	1	82.5	균열,침하	인력, t=10cm		○		382



연번 No.	위치		행선	폭(m)	연장(m)	개소	면적(m <sup>2</sup> )	현황	보수방법	작업조건		비고	조사번호
	노선명	공사구간(지점)								주간	야간		
32	행당로	76 행당한진타운아파트 101동앞	고산자로방향 1차로	3.2	20	1	64	균열	인력, t=10cm		○		383
33	행당로	76 CU	고산자로방향 1차로	3.2	25	1	80	균열	인력, t=10cm		○		384
34	독서당로	187 국민은행	시내방향 2차로	3.2	15	1	48	균열	인력, t=5cm		○		392
35	독서당로	187 한샘리하우스	시내방향 1차로	3	15	1	45	균열	인력, t=5cm		○		393
36	독서당로	155	시내방향 2차로	4.3	11	1	47.3	균열	인력, t=5cm		○		394
37	독서당로	155	시내방향 1차로	3.2	15	1	48	균열	인력, t=5cm		○		396
38	독서당로	155	시내방향 2차로	4.2	11	1	46.2	균열	인력, t=5cm		○		397
39	독서당로	155	시외방향 1차로	3.4	14	1	47.6	균열	인력, t=5cm		○		399
40	독서당로	155	시외방향 1~2차로	5	9.7	1	48.5	균열	인력, t=5cm		○		401
41	서울시립대로	146	시립대방향 3차로	3.9	12.5	1	48.75	균열,포트홀,침하	인력, t=5cm		○		404
42	전농로	131	천호대로방향 1차로	3.2	13	1	41.6	균열	인력, t=5cm		○		405

# 위치도



No. 1



No. 2





No. 3





No. 4





No. 5





No. 6



No. 7






No. 8









No. 17

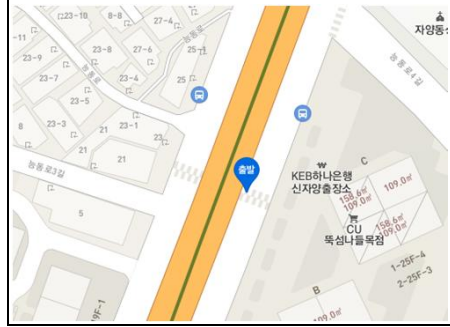



No. 18



No. 19





No. 20

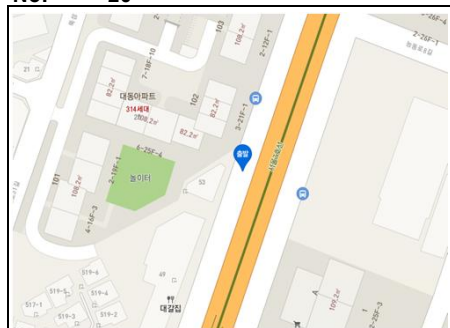



No. 21



No. 22



No. 23





No. 24










No. 25






No. 26





No. 27

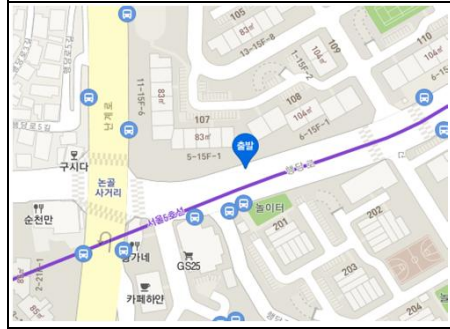



No. 28

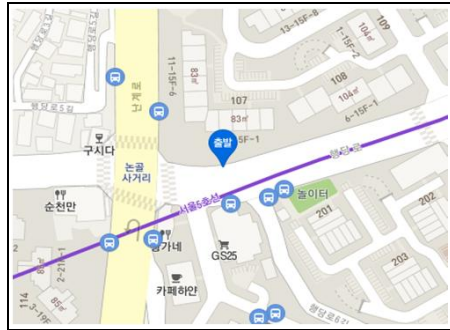




No. 29




No. 30



No. 31



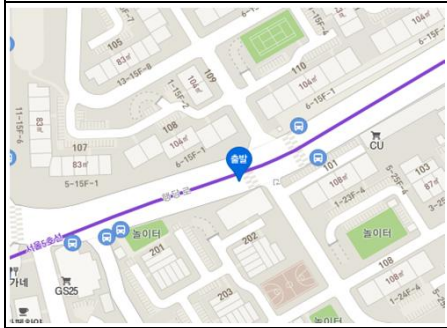


No. 32



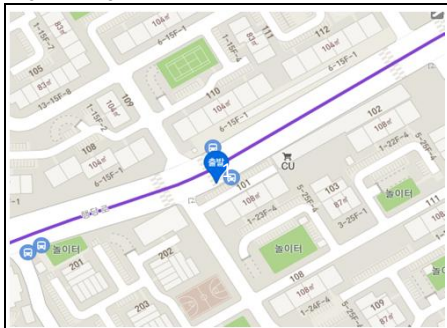







No. 37

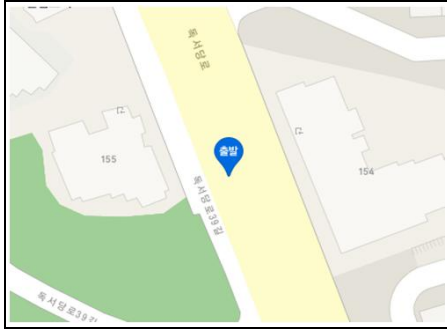




No. 38

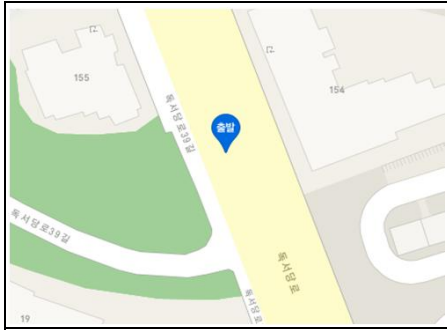



No. 39

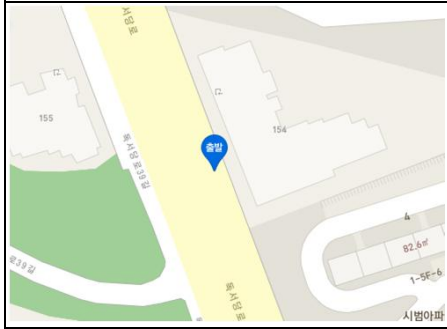



No. 40

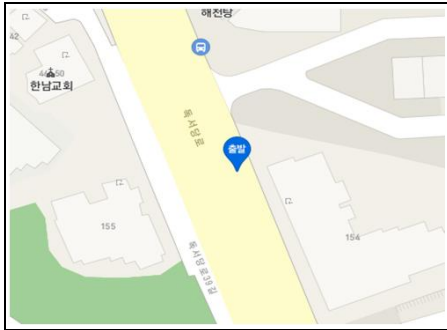





No. 41







No. 42



No. 43



No. 44



# 8차지시(소파작업) 전체 위치도(조사번호)

- = 소파 보수(T=10cm)
- = 소파 보수(T=5cm)

